

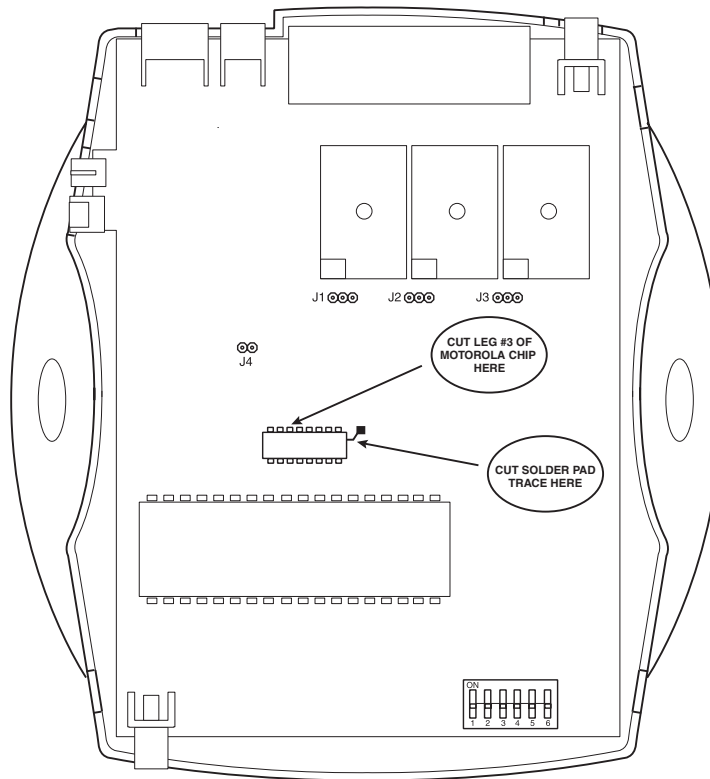
**Date:** 10/98**Number of Pages:** 1**Reference #:** 00106

**Subject:** In some GM vehicles, a faint extra chirp may be heard when the MS8200/8300 is connected to the positive trigger door locking system.

**Description:**

Cut the third leg from the left on the small microchip pictured below. Next cut the trace leading to the solder pad directly next to the microchip. This will eliminate any faint chirps heard when locking the doors either by remote, or with the switch in the vehicle.

Performing this modification will not adversely affect the operation of the MS8200/8300 in any way.

**Notes:**

**Ungo Security Corporation**  
661 West Redondo Bach Bl.  
Gardena, CA 90247  
Ph. 310-327-9100  
Fax 310-327-1999